

**Product: 2018-LED**

Release Date: March 31, 2006

Scope: This bulletin applies only to the LED version of the 2018 running firmware version 01.02.01.

Issue 1: When a Yellow Disable Jumper is Installed Constant Conflicts May Occur that Seem to have no Explanation.

Symptom: After installing Yellow Disable jumpers for any channels, the monitor may seem to be in a constant state of conflict with channels that are permissive.

Root Cause: A programming error in the implementation of the Yellow Disable jumpers caused channels 17 and 18 to always cause a conflict even when not on or not being used (16 channel mode) when any yellow disable jumper was installed. This error was introduced in the 01.02.01 firmware and does not exist in prior versions.

Operational Issues: While Yellow Disable jumpers were installed, the monitor may only operate for 333ms before tripping to a Conflict fault. If the monitor ran normally for more than one second, this error was not an issue in its configuration.

Corrective Action: Upgrade to 2018 Firmware version 01.02.02 or greater.
